DPR Kit Instructions



■ Before handling or applying any product, read the Safety Data Sheet. Wear safety glasses and gloves while handling kits.

For best results:

Condition kits to \geq 60°F (15°C) before using. Kits are designed for single use. Do not divide.

- Prepare repair area: Remove loose materials. Dry all moist areas and cracks. Wire brush surfaces to remove dust and dirt. Blow area and cracks clean with dry compressed air.

 Caution: moisture will prevent bonding.
- Use "eggbeater" style mixer with a drill capable of ≥400 RPM.
- Open Kit, remove packaged materials and set aside. Leave aggregate in bucket.

Tear open Part A package and pour into bucket with aggregate.

Mix for 2 minutes. Scrape bucket sides and bottom with provided scraper.

Kit Options:


Black color: add black color pack to Part A + Aggregate & mix Gray (standard) color: do not add black color pack FastPatch® Kicker: Add Kicker to speed up cure time at colder temperatures

Gravel: Increase kit yield, add 1 gallon clean & dry 3/8" pea gravel

- Tear open Part B package and pour into bucket with mixture of Part A & aggregate. Mix for an additional 2 minutes. Scrape bucket sides and bottom with provided scraper.
- Immediately after mixing, **pour the mixed material into repair area.** Material should be level to surrounding surface.
- Natural or black topping sand may be applied to match surrounding surface. Apply topping sand to refusal when material has started to cure, typically after 10 minutes.

Curing: 1 hour at 75° F (25° C) or 2-3 hours for 50-65° (10-18° C) Store DPR between 65-75° F (18-25° C) before use. Use Kicker to speed cure in cooler temperatures (sold separately). Recommend: 1 bottle of Kicker below 55° F (12° C)

Shelf life: 1 year for unopened container.

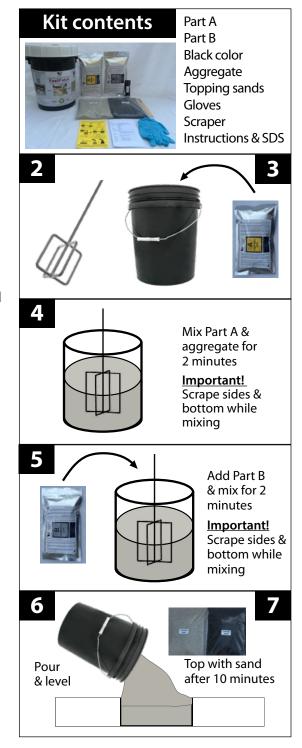

Revised May 2024